

# Addendum to the Release Notes for the Accelar 1000 Series Products

## Software Release 1.1.7

4401 Great America Parkway  
Santa Clara, CA 95054

8 Federal Street  
Billerica, MA 01821

Part No. 202693-C  
October 1998



Bay Networks



\* 2 0 2 6 9 3 - C \*

**Copyright © 1998 Bay Networks, Inc.**

All rights reserved. Printed in the USA. October 1998.

The information in this document is subject to change without notice. The statements, configurations, technical data, and recommendations in this document are believed to be accurate and reliable, but are presented without express or implied warranty. Users must take full responsibility for their applications of any products specified in this document. The information in this document is proprietary to Bay Networks, Inc.

**Trademarks**

Bay Networks is a registered trademarks of Bay Networks, Inc.

Accelar, LinkSafe, and the Bay Networks logo are trademarks of Bay Networks, Inc.

Microsoft and Windows are registered trademarks of Microsoft Corporation.

All other trademarks and registered trademarks are the property of their respective owners.

**Statement of Conditions**

In the interest of improving internal design, operational function, and/or reliability, Bay Networks, Inc. reserves the right to make changes to the products described in this document without notice.

Bay Networks, Inc. does not assume any liability that may occur due to the use or application of the product(s) or circuit layout(s) described herein.

---

## Introduction

This release note addendum for Accelar software release 1.1.7 describes the enhancements and bug fixes to the Bay Networks® Accelar™ software that have been implemented since release 1.1.1. This document is an addendum to the *Release Notes for the Accelar 1000 Series Products Software Release 1.1.1* (Bay Networks part number 896-00181-C) and includes references to those fixes incorporated into interim releases 1.1.2 through 1.1.6, as well as 1.1.7.

Software release 1.1.7 includes updates to the run-time software only. The boot monitor, Device Manager, and VLAN Manager versions have not changed. The compatible software components are:

- Run-Time Software Version 1.1.7 (acc1.1.7)
- Boot Monitor Software Version 1.1.1 (accboot1.1.1)
- Device Manager and VLAN Manager Version 1.1.3

Refer to the 1.1.1 Release Notes (part number 896-00181-C) for instructions to download the software and for descriptions of software features and limitations.



**Note:** Software release 1.1.7 and all prior releases do not support switches or modules with ARU2 ASICs. These switches and modules require software release 1.3.0 or higher.

Software release 1.1.7 and all prior releases do not support the realtime clock on the newer CPU boards. Use release 1.3.0 or higher if this functionality is required.

---

## New Features

This section lists the new features that have been added in release 1.1.7, as well as those that were added in release 1.1.6.

## Release 1.1.7

The following features were added in release 1.1.7:

- Two new commands, `save nvram standby` and `save standby`, have been added to allow users with redundant Silicon Switch Fabric (SSF) modules to simultaneously save configuration changes to both the active and standby SSF modules. (79295)
- An optional parameter (`-s`) has been added to the `route show` command to allow the user to see a range of subnets. For example, entering the command `route show -s 8.8.0.0/15` will show all subnets within the given subnet mask. (82018)
- Trace and log messages now show days in system uptime. (82311)

## Release 1.1.6

The following features were added in release 1.1.6:

- IP address has been added as an optional parameter to the CLI `route show` and `arp show` commands. (78153, 78154)

The `route show` command now allows the following formats:

```
route show x.  
route show x.x.  
route show x.x.x.
```

Note that you must add a period (.) to terminate the IP network identification, or the number will be interpreted as an IP address. For example, typing “10.10” will be interpreted as 10.0.0.10. Typing “10.10.” will be interpreted as 10.10.x.x. The same formats apply to the `arp show` command.

- Accelar now has a link-flapping detection feature that detects ports whose link signal is unstable and administratively disables these ports to avoid potential network instability. Any port that makes more than 10 link-state transitions in a 1-minute period will be automatically disabled, an SNMP trap will be sent, and a warning message will be written to the console and the log file indicating that such an event has taken place.
- A new `port clear stats [<port>]` command has been implemented. Using this command allows you to reset statistics for a given port or for all ports. (78856)

- In the CLI display, the "--More--" function has been implemented in the same manner as in UNIX systems, with the display incrementing one line at a time when you press the Enter key, instead of a whole page. No other key functions have been changed. (78856)

## Bugs Fixed

This section lists the bugs from release 1.1.1 that have been fixed in later releases. For clarification, they are listed by the specific interim release in which the fix occurred.

### Release 1.1.2

The following bugs were fixed in release 1.1.2:

- The Accelar switch did not forward DHCP negative acknowledgments (NAKs). (2120)
- The RcvBadRoutes counter did not increment when a bad metric was received for RIP. (2112)
- Multicast MAC addresses were not accepted in ARP response packets.
- Too many ARP requests were sent out in response to the deletion of a MAC address.
- Data corruption occurred on back-to-back frames sent out by the CPU. (2113)

### Release 1.1.3 and 1.1.3.1

These releases pertained to the Accelar 1050/1051 Routing Switch only. The following bugs were fixed:

- The Accelar 1050/1051 switch entered Diagnostic mode after a cold start.
- Some inaccurate counter values occurred in the Accelar 1050/1051 switch. (1928)

## Release 1.1.4

The following bugs were fixed in release 1.1.4:

- An expired timeout value for a configuration BPDU was ignored and the BPDU was not dropped, which resulted in the root bridge oscillating between two bridges.
- When a RIP-learned route timed out and there was a less specific static route configured, the timed-out route was not deleted. (1949)

## Release 1.1.6

The following bugs were fixed in release 1.1.6:

- Management “blackouts” occurred as a result of synchronous cleanup of MAC address records in the ARU.
- In some configurations, there were no responses to ARP requests.
- In Gigabit Ethernet ports, the LinkSafe™ redundant port did not take over when the receive connection was lost and the transmit connection was operating correctly. With this fix, if the link partner is a GMAC2 or “ForceLink” port, local autonegotiation MUST BE FALSE (non-autonegotiation) for proper operation.
- A less specific static route removed a more specific learned route. Also a learned route could not be added if a less specific static route was configured. (78220)
- An IP subnet broadcast or a ping of a local IP address from the console caused the Accelar switch to run out of frame buffers. (79595)
- The Accelar switch stopped processing IP packets when it received a packet destined for itself. (79454)
- RIP updates with a next hop address field of the Accelar VLAN address would lose the VLAN IP address. (79581)
- When the switch fabric was busy, CPU-generated traffic (for example, BPDUs) could egress the switch with FCS errors. This problem also sometimes appeared as a management slowdown. (80162)
- The OSPF AsExternal Type 2 route was selected over the Intra-route. (80341)
- Accelar considered a “0” host for a subnet address as not configured in the switch. (80151)

- Traffic forwarded via the default route had a Destination MAC address of all zeros (0s). (80020)
- In a configuration of two or more Accelar switches, connectivity was lost when used in combination with HSRP. (78014)
- When the switch fabric was busy and the CPU was attempting to queue cells to transmit, cell buffer overruns sometimes occurred, delaying the actual transmission of the frames. This problem also sometimes appeared as a management slowdown.
- When a learned route superseded a static route, and the learned route disappeared, the static route was not used. (79643)
- Some circular Spanning Tree configurations became unstable when a link was removed and reinserted.

## Release 1.1.7

The following bugs were fixed in release 1.1.7:

- Routes “flapping” in redundant networks could cause the Accelar switch to forward packets to an all zeros (0s) MAC address. (81722)
- In some VLSM configurations, directed broadcasts were routed back to the original network. (83353)
- The CLI will now check for the maximum number (500) of static routes allowed. (83456)
- Static routes could be overwritten by RIP-learned routes. (82849)
- Gigabit links could fail to initialize after booting. (82301)
- A consistency check was added for nonexisting IP addresses to prevent the Accelar switch from crashing if these addresses are used when configuring area IDs. (84350)
- Connectivity problems in VINES and AppleTalk policy-based VLANs have been corrected. (79992)
- The Accelar switch no longer sends unnecessary ARP requests for the source address of ingressing broadcast or directed broadcast packets. (82284)
- The version number in the Web management page was incorrect. (82841)
- In a LinkSafe configuration, Gigabit ports remained in forwarding mode after the remote switch was powered down. (81410)

- In the MIB interface table, ifTypes associated with VLANs returned “illegal enum” messages, which caused NetView discovery problems. (82941, 85496)
- Frame buffers did not get released when receiving address mask request packets. (85569)
- RMON-corrupted trap packets caused Device Manager for Windows® to crash. (84939, 84993)
- A spanning tree blocked trunk port would hold the previously learned MAC address. (85016)
- Static routes took precedence over local routes after rebooting. (84796)
- When the switch fabric was busy and the CPU attempted to queue cells to transmit, cell buffer overruns sometimes occurred, delaying the actual transmission of frames. This problem also sometimes appeared as a management slowdown.
- Potential members could be prematurely removed from a VLAN. (81336)
- The Accelar switch could run out of frame buffers in networks where the HP JetAdmin 2.33 utility was heavily used. (86208)
- When a spanning tree port received its own BPDU, it would go into a permanent blocked state, even if the situation was corrected. (84881)
- You could not add a static route if a RIP-related route already existed. (77562)
- Traceroute did not function correctly over trunk links. (79794)